

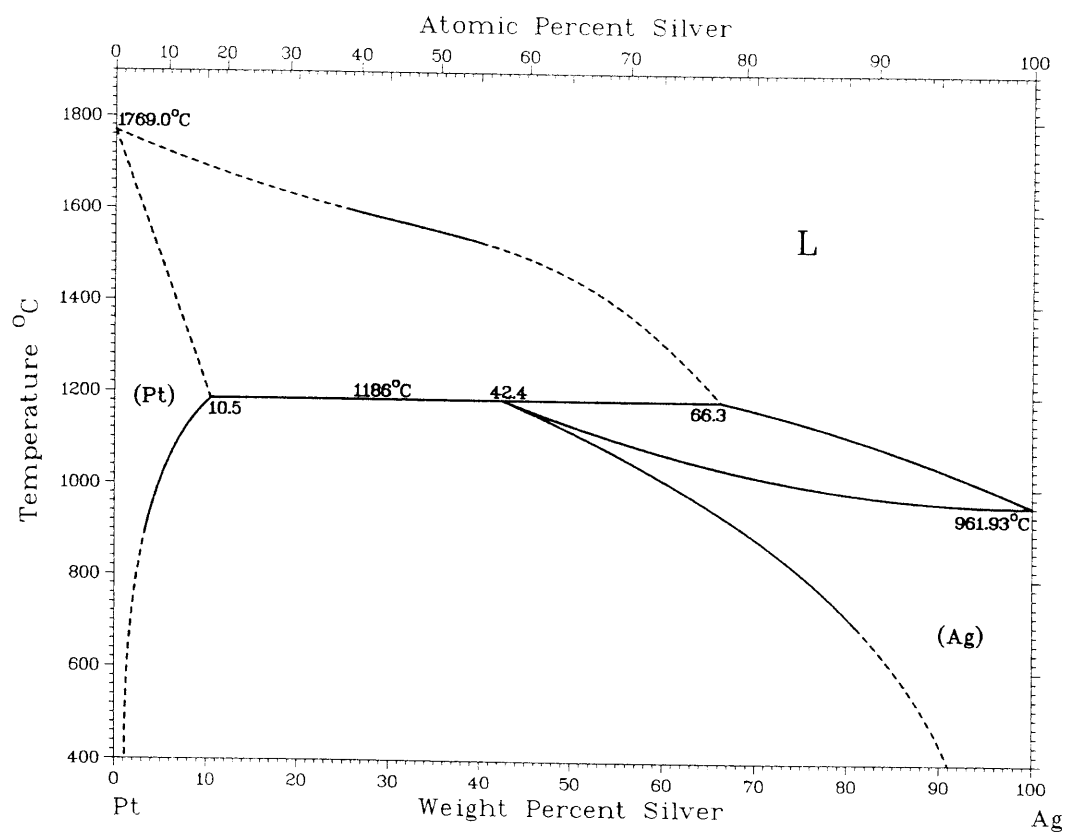
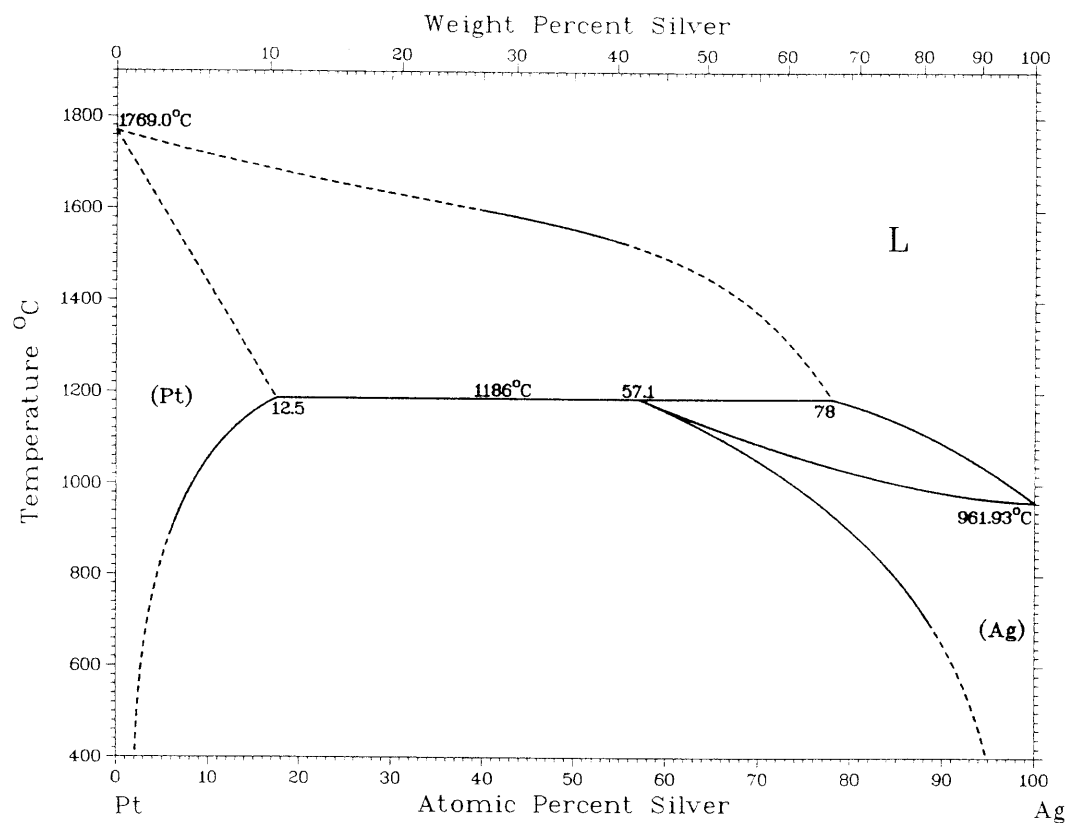


Pt-Ag Phase Diagram

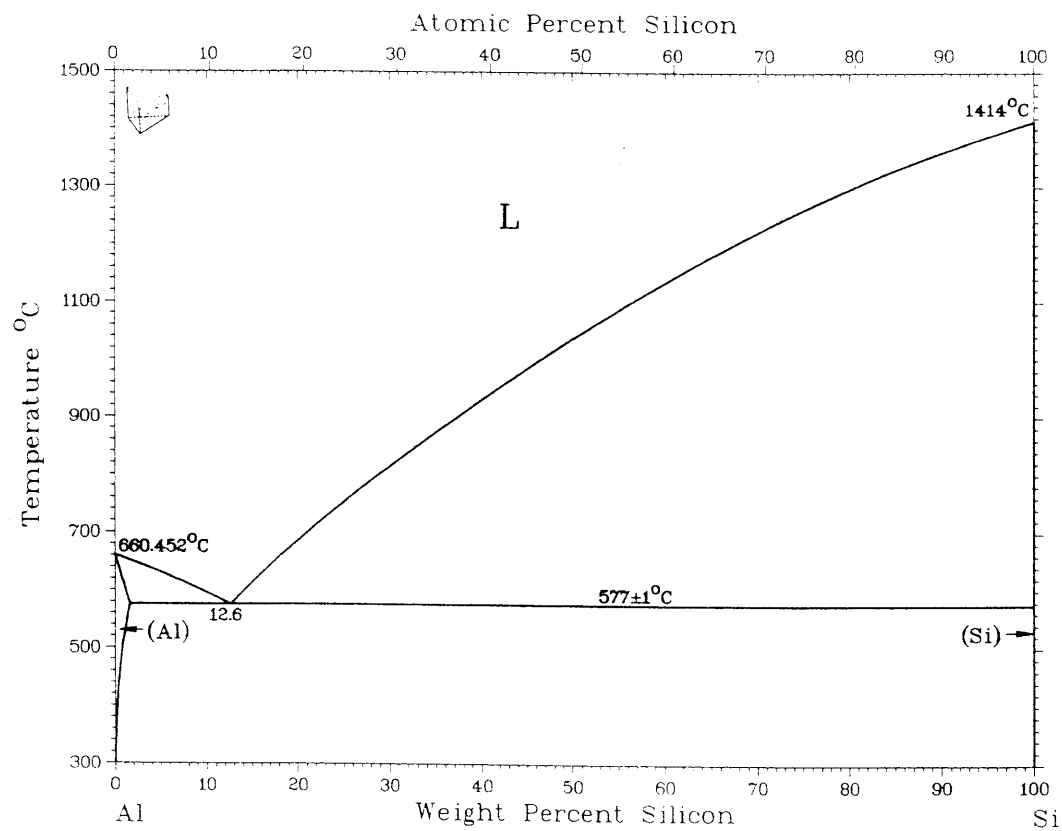



From [Metals].

Assessed Al-Si Phase Diagram

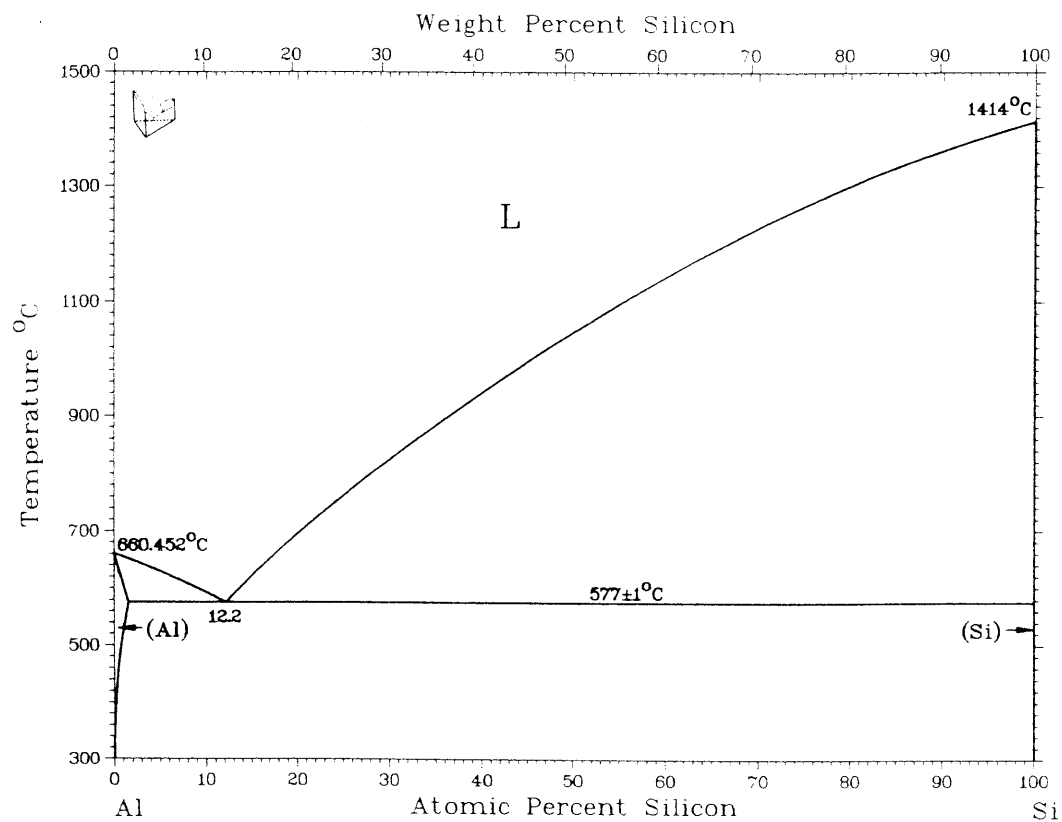


J.L. Murray and A.J. McAlister, 1984.



Pb-Sn Phase Diagram

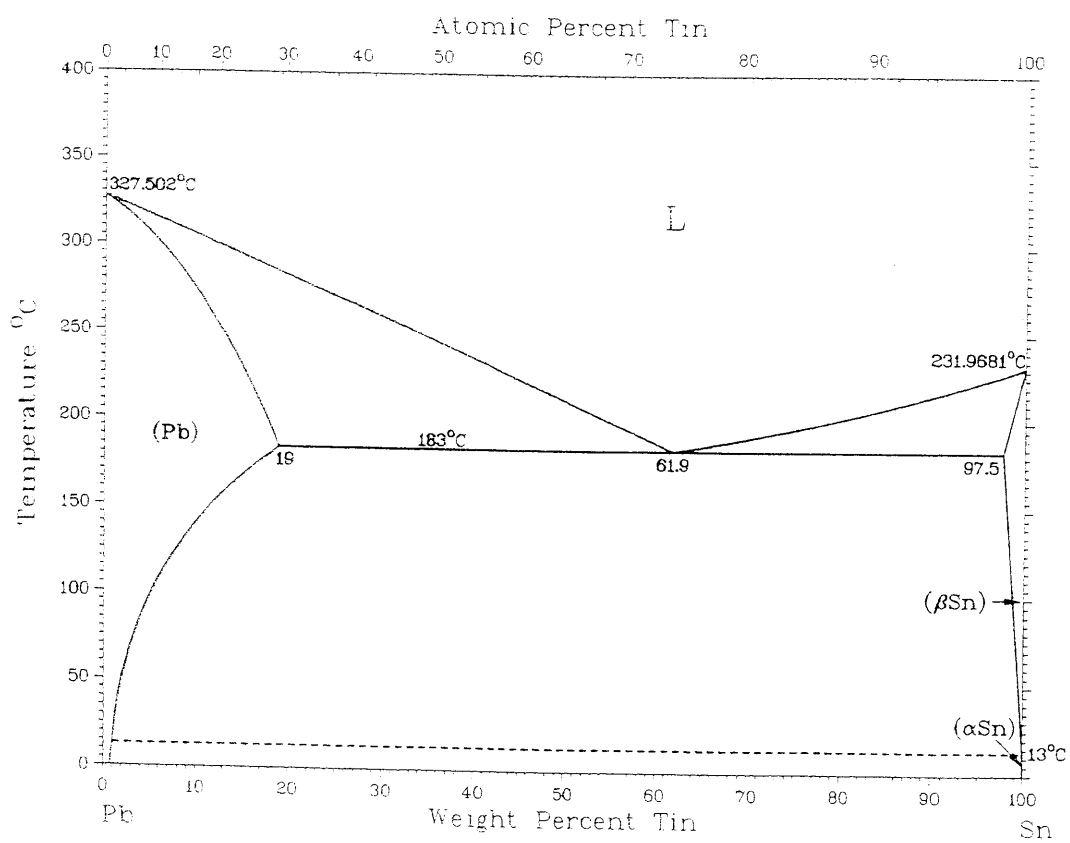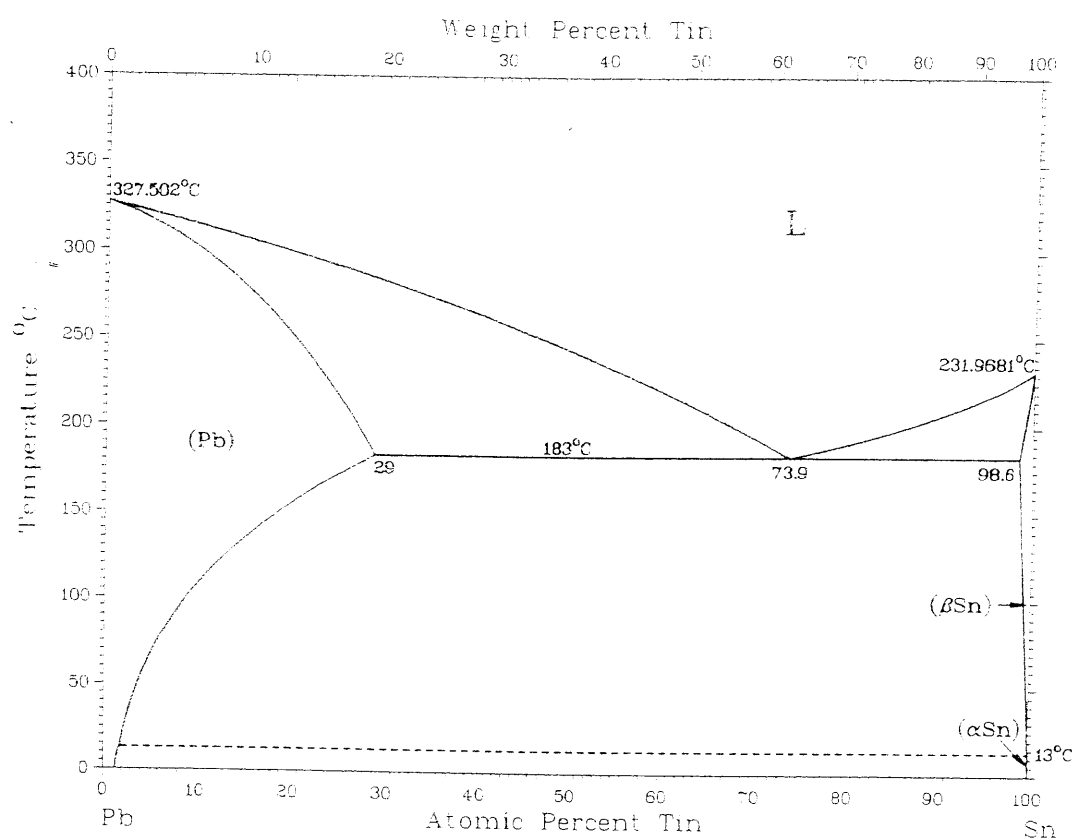

From [Metals]

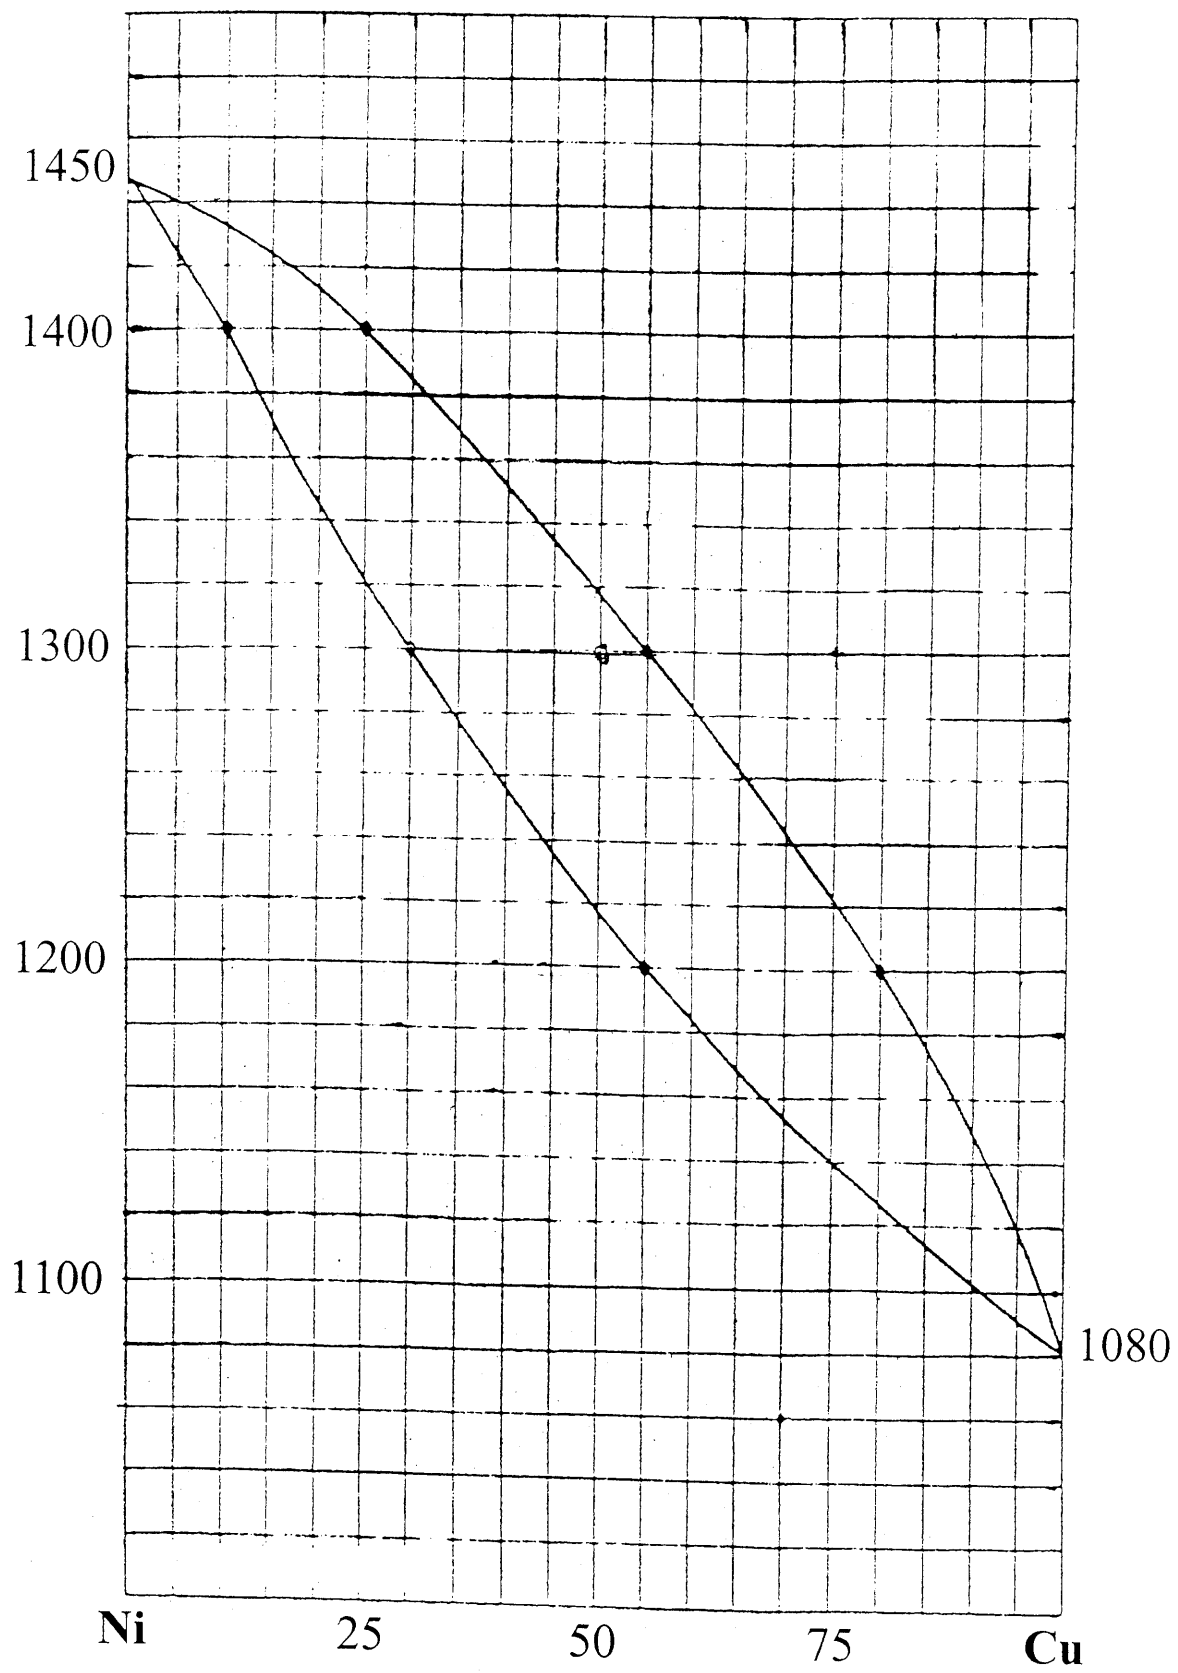



Assessed Au-Si Phase Diagram

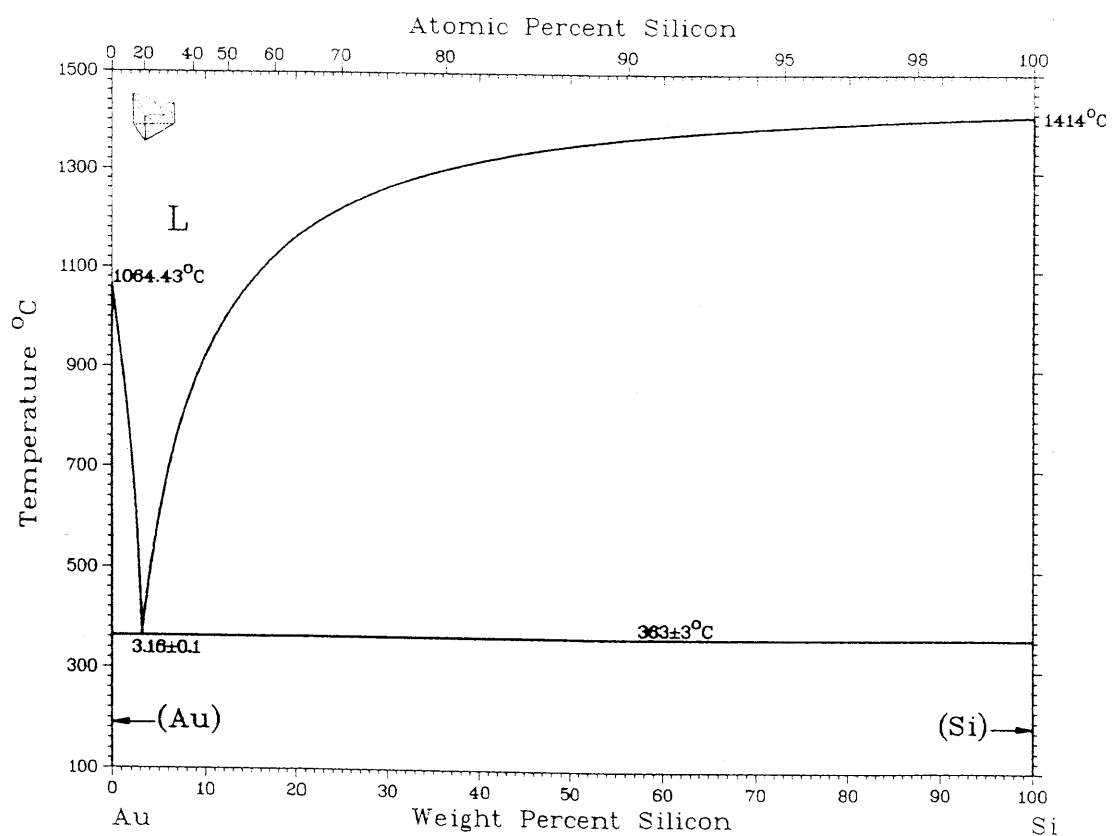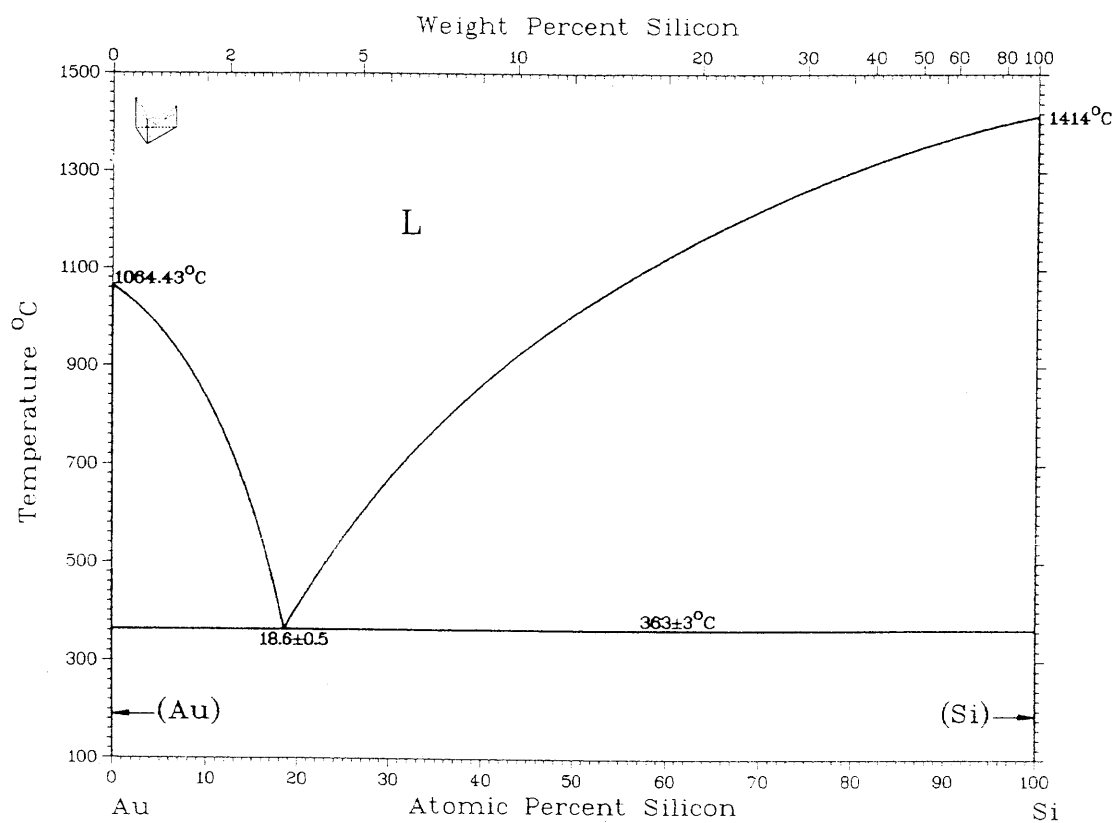

H. Okamoto and T.B. Massalaski, 1983.

As-Ga

Ga-As Phase Diagram

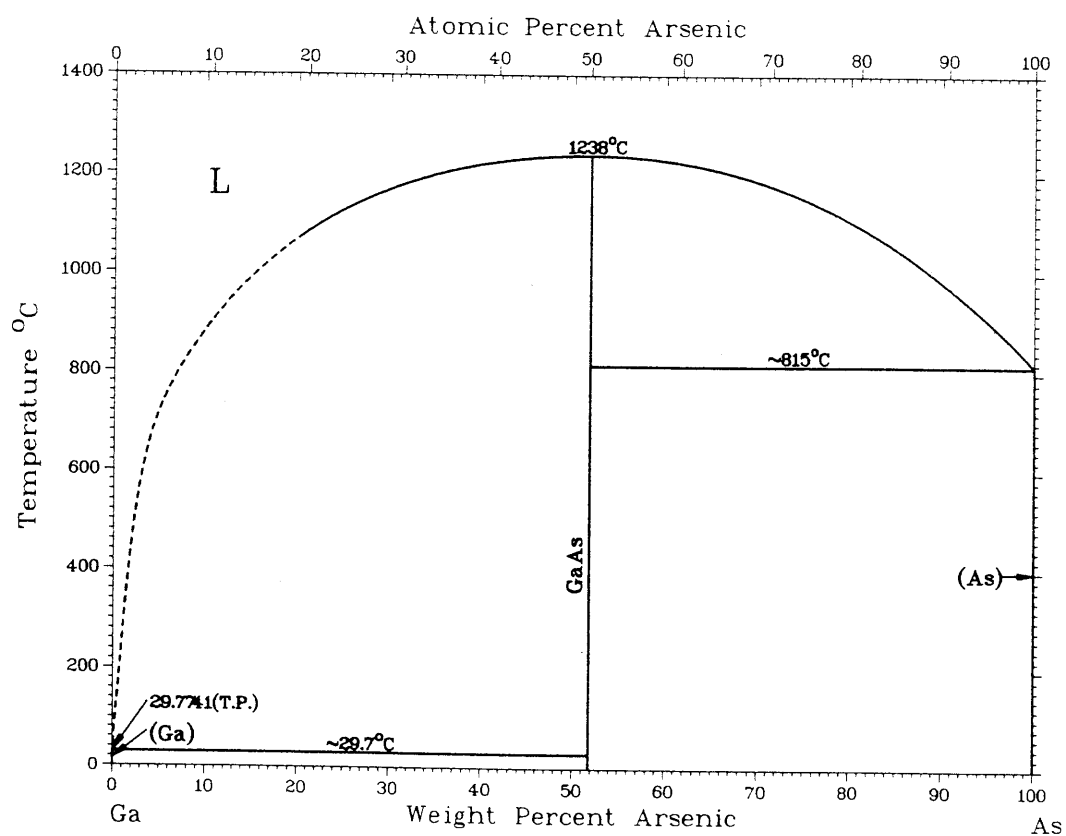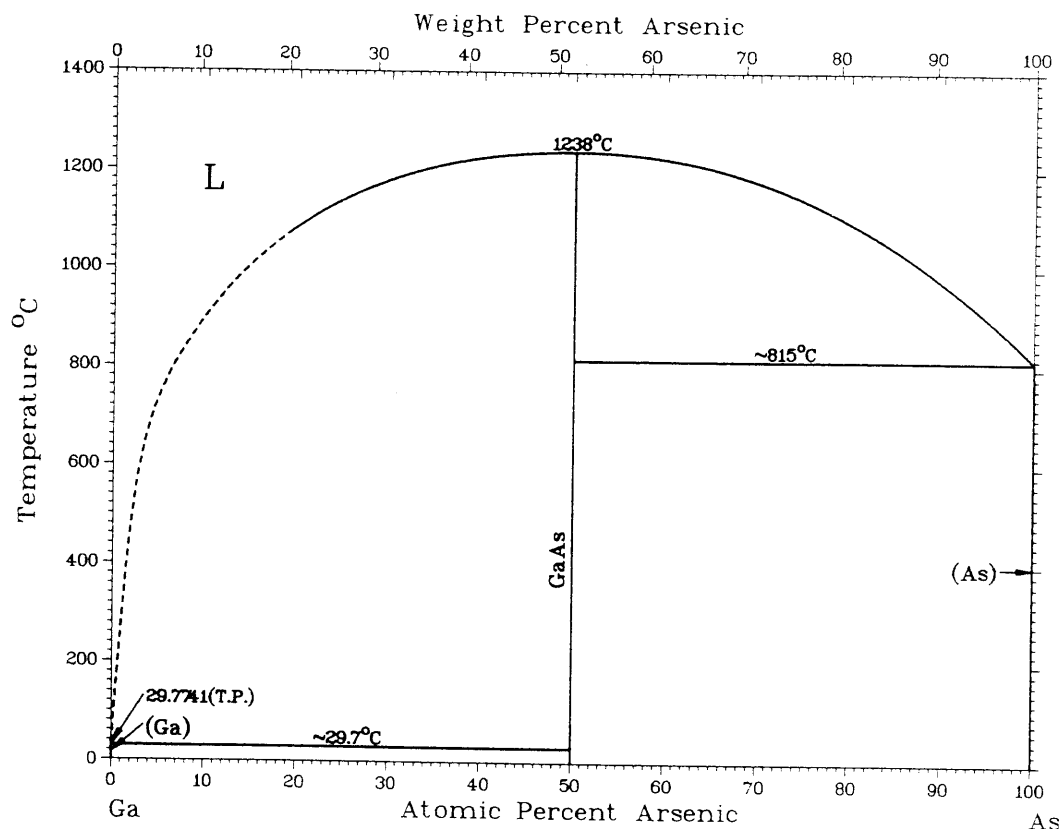

From [Hansen].



$$Ge(T_f) = 2210,4 K$$

$$\Delta H_{fus} = 36944 J \cdot mol^{-1}$$

O. Knochel; O. Kubaschewski; K. Hesselmann pp. 767 Vol. I

Ge-In

Assessed Ge-In Phase Diagram

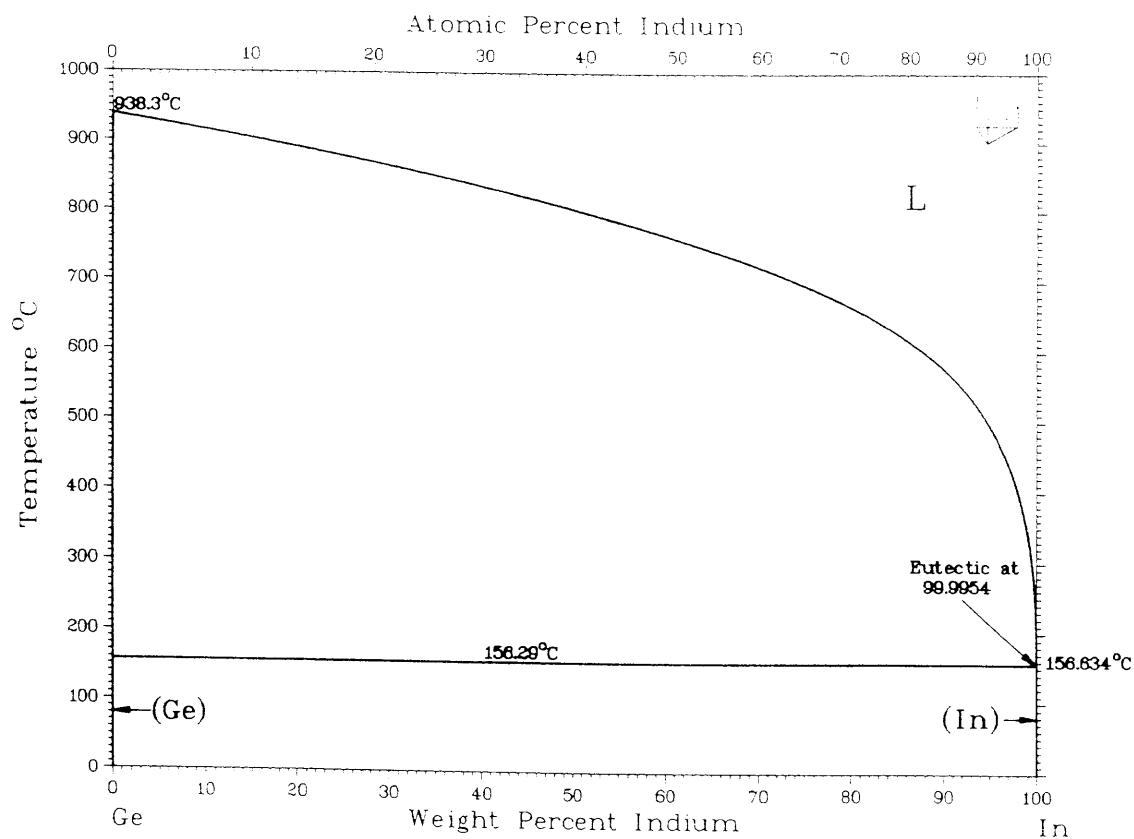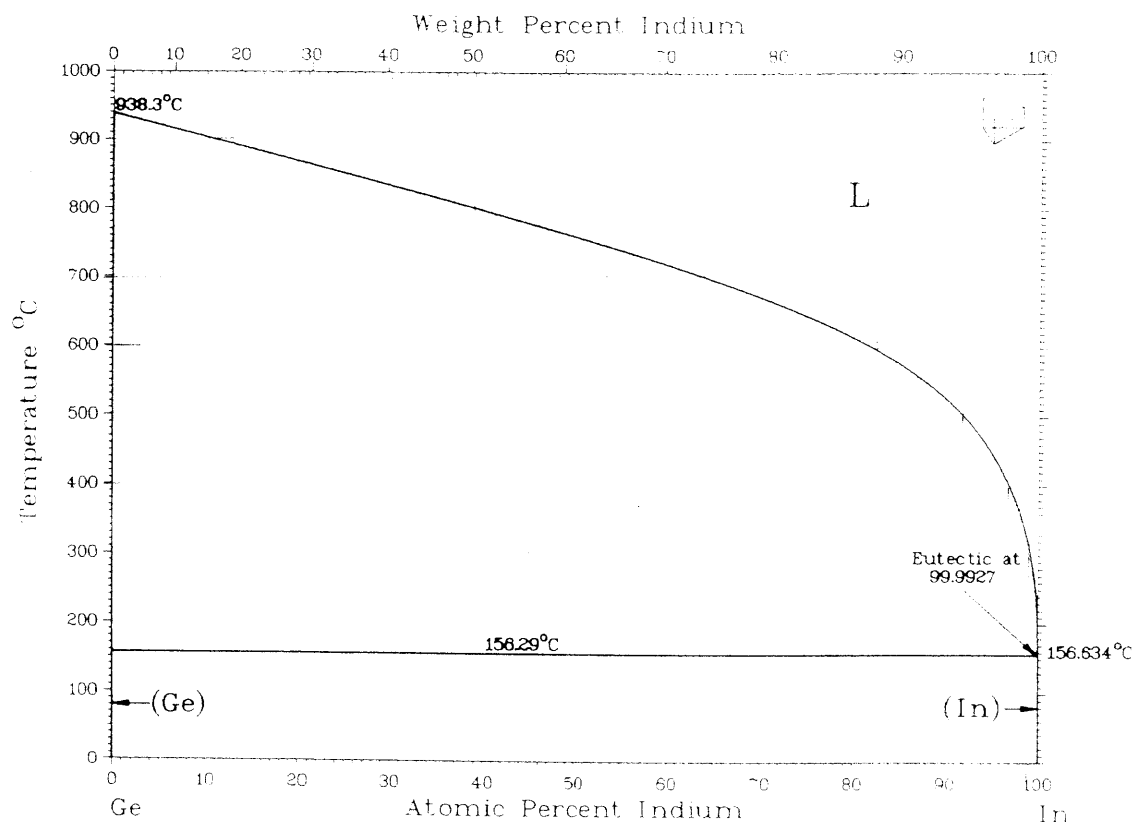

R.W. Olesinski, N. Kanani, and G.J. Abbaschian, 1985.